


m	r	m/kg	LM 1																					
			m/kg																					
			14,0	16,0	18,0	20,0	22,0	24,4	26,9	30,0	32,5	35,0	37,5	40,0	42,5	45,0	47,5	50,0	52,5	55,0	57,5	60,0	62,5	
62,5 (r=64,0)			2,6 – 13,6 8000	7770	6720	5900	5240	4700	4170	3720	3260	2960	2700	2470	2270	2100	1940	1800	1680	1560	1460	1370	1280	1200
60,0 (r=61,5)			2,6 – 15,1 8000	8000	7540	6630	5900	5300	4710	4210	3700	3360	3070	2820	2600	2410	2230	2080	1940	1820	1700	1600	1500	
57,5 (r=59,0)			2,6 – 15,1 8000	8000	7560	6640	5910	5310	4720	4220	3710	3370	3080	2830	2610	2410	2240	2090	1950	1820	1710	1600		
55,0 (r=56,5)			2,6 – 17,0 8000	8000	8000	7540	6720	6050	5380	4820	4250	3870	3540	3260	3010	2800	2600	2430	2270	2130	2000			
52,5 (r=54,0)			2,6 – 17,1 8000	8000	8000	7600	6780	6100	5430	4860	4290	3900	3580	3290	3040	2820	2630	2450	2290	2150				
50,0 (r=51,5)			2,6 – 18,9 8000	8000	8000	8000	7540	6800	6060	5430	4800	4380	4010	3700	3430	3180	2970	2770	2600					
47,5 (r=49,0)			2,6 – 19,0 8000	8000	8000	8000	7610	6850	6110	5480	4840	4420	4050	3730	3460	3210	2990	2800						
45,0 (r=46,5)			2,6 – 20,6 8000	8000	8000	8000	8000	7480	6670	5990	5300	4840	4440	4100	3800	3540	3300							
42,5 (r=44,0)			2,6 – 20,7 8000	8000	8000	8000	8000	7500	6700	6010	5320	4860	4460	4120	3820	3550								
40,0 (r=41,5)			2,6 – 21,3 8000	8000	8000	8000	8000	7750	6920	6210	5500	5020	4610	4260	3950									
37,5 (r=39,0)			2,6 – 21,3 8000	8000	8000	8000	8000	7730	6900	6200	5490	5010	4600	4250										
35,0 (r=36,5)			2,6 – 21,5 8000	8000	8000	8000	8000	7810	6970	6260	5540	5060	4650											
32,5 (r=34,0)			2,6 – 21,4 8000	8000	8000	8000	8000	7790	6960	6250	5530	5050												
30,0 (r=31,5)			2,6 – 21,5 8000	8000	8000	8000	8000	7820	6980	6270	5550													
26,9 (r=28,4)			2,6 – 21,4 8000	8000	8000	8000	8000	7800	6960	6250														
24,4 (r=25,9)			2,6 – 21,5 8000	8000	8000	8000	8000	7840	7000															



		m/kg																			LM 2	
m	r	m/kg	16,0	19,0	22,0	25,0	28,0	31,0	34,0	37,0	40,0	42,5	45,0	47,5	50,0	52,5	55,0	57,5	60,0	62,5		
62,5 (r=64,0)	2,6 – 15,1 8000		7530	6230	5280	4560	4000	3540	3170	2850	2590	2390	2220	2070	1930	1800	1690	1580	1490	1400		
60,0 (r=61,5)	2,6 – 16,5 8000		8000	6870	5840	5060	4440	3950	3540	3190	2900	2690	2500	2330	2180	2040	1920	1800	1700			
57,5 (r=59,0)	2,6 – 16,5 8000		8000	6890	5850	5060	4440	3950	3530	3190	2900	2690	2500	2330	2180	2040	1910	1800				
55,0 (r=56,5)	2,6 – 18,3 8000		8000	7690	6550	5680	5000	4450	3990	3610	3290	3050	2850	2660	2490	2340	2200					
52,5 (r=54,0)	2,6 – 18,4 8000		8000	7750	6590	5720	5030	4470	4010	3630	3310	3070	2860	2670	2500	2350						
50,0 (r=51,5)	2,6 – 20,1 8000		8000	8000	7250	6300	5550	4940	4450	4030	3680	3420	3190	2980	2800							
47,5 (r=49,0)	2,6 – 20,2 8000		8000	8000	7300	6340	5580	4980	4470	4050	3700	3440	3210	3000								
45,0 (r=46,5)	2,6 – 21,9 8000		8000	8000	7990	6950	6130	5470	4920	4470	4080	3800	3550									
42,5 (r=44,0)	2,6 – 22,0 8000		8000	8000	8000	6960	6140	5470	4930	4470	4080	3800										
40,0 (r=41,5)	2,6 – 22,5 8000		8000	8000	8000	7140	6300	5620	5060	4600	4200											

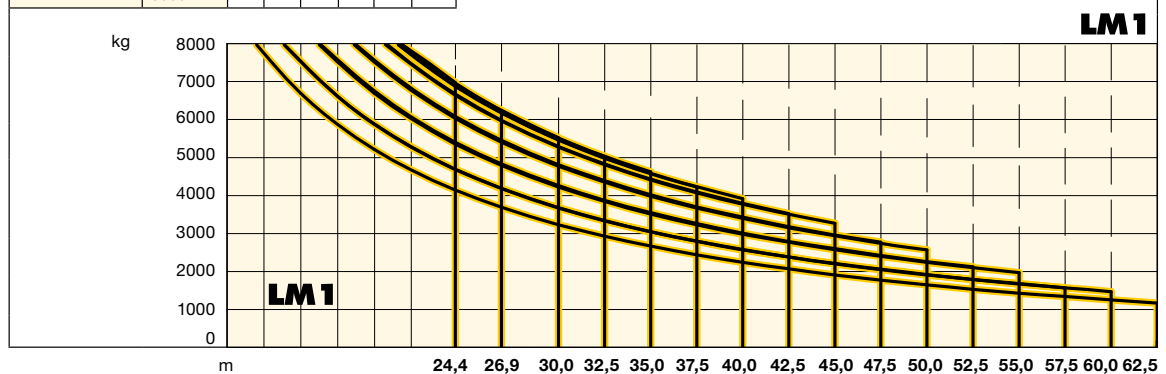